


TROWELED BEAD OF POLYGUARD DETAIL SEALANT PW OR POLYGUARD LM-95 APPLIED TO TOP EDGE OF REPAIR PATCH AND TOOLED TO A FEATHERED EDGE - ADHESIVE OR SEALANT APPLICATION NOT REQUIRED

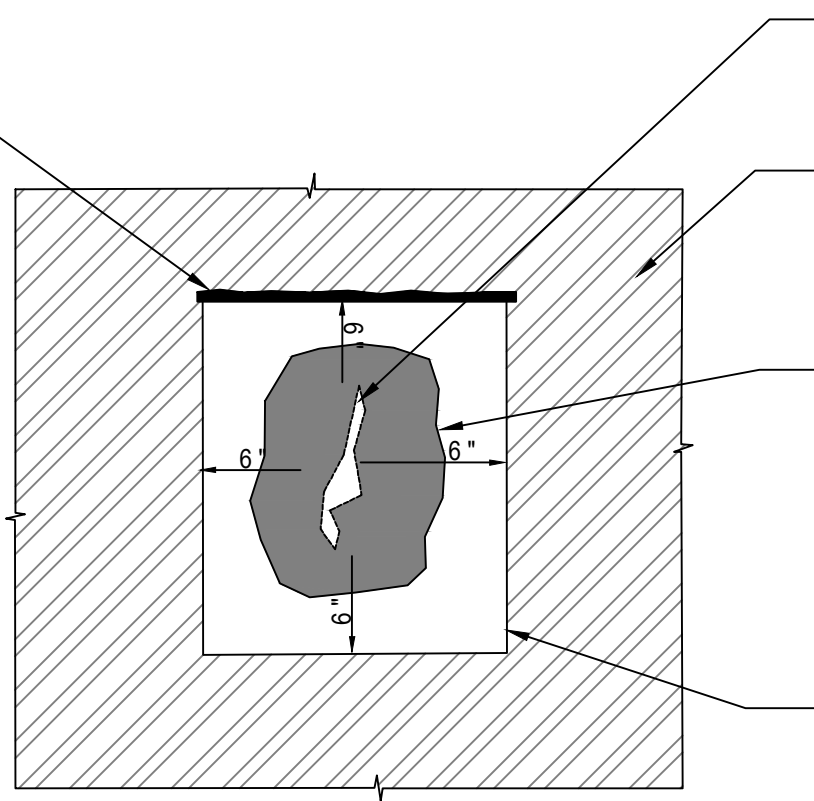

REPAIR AREA

POLYGUARD BLINDSIDE MEMBRANE FABRIC FACING CONCRETE POUR

MINIMUM 60 MILS OF POLYGUARD LM-95 COVERING THE DAMAGED AREA AND EXTENDING A MINIMUM OF 1" BEYOND DAMAGE IN ALL DIRECTIONS OVER FABRIC OF POLYGUARD BLINDSIDE MEMBRANE PREPARED WITH POLYGUARD 650 LT LIQUID ADHESIVE OR POLYGUARD CALIFORNIA SEALANT AT A RATE OF 50 - 75 SF/GAL PRIOR TO POLYGUARD LM-95

POLYGUARD FABRIC TAPE APPLIED A MINIMUM OF 6" IN ALL DIRECTIONS PAST DAMAGE AND ONTO POLYGUARD BLINDSIDE AND CURED POLYGUARD LM-95 - PREPARE FABRIC OF POLYGUARD BLINDSIDE WITH POLYGUARD 650 LT LIQUID ADHESIVE OR POLYGUARD CALIFORNIA SEALANT AT A RATE OF 50 - 75 SF/GAL

**BS8**

**SECTION @ REPAIR PATCH OVER DAMAGE LESS THAN 2"**

<small>The information provided is based on data and knowledge considered to be true and accurate and is offered for the users' consideration, investigation and verification, but we do not warrant the results to be obtained. Please read all data sheets, statements, recommendations or suggestions in conjunction with our conditions of sale, which apply to all goods supplied by us.</small>	NOT TO SCALE
	EFFECTIVE DATE: 07/15/2024
	SUPERCEDES: 10/01/2022